

Roof Curb Service Bulletin - 10-11-2011

A defect in the two shorter sides for part numbers 14CURB3672B, 14CURB90150, 14CURB180240 and PGC101/102/103 has been detected. Incorrect notching on shorter pieces of the affected parts results in the curbs being approximately ½” larger than specified when assembled. As a result the insulated panels and duct supports do not fit into the curb properly.


McDaniel Metals is currently in the process of re-manufacturing the narrow sides with proper notching for replacement in the parts where the defect is present. We propose that, rather than cut the bands on the curbs and replacing the defective parts, we build and send correct sides separately that can be included with the entire curb package at the time of sale with explicit instructions to discard the parts included with the curb in favor of the replacement sides. In places where a great deal of defective inventory is present we would send replacement inventory and provide advice on how to return the incorrect parts to McDaniel Metals at our expense.

On the curb label is a job number (circled below) that may help in determining if current inventory is affected. The photo below depicts the location of the job number and the table that follows identifies the job numbers that are present on the flawed curbs.



14CURB3672B	14CURB90150	14CURB180240	PGC101/102/103
2471	2494	2497	2495
2547	2619		2618
2602	2696		
2697	2731		
2752			

A measurement may also be taken in the location depicted in the second photo of the side with the 'hooks' to determine if the part is defective as well. Please see the accompanying table for the correct measurements.

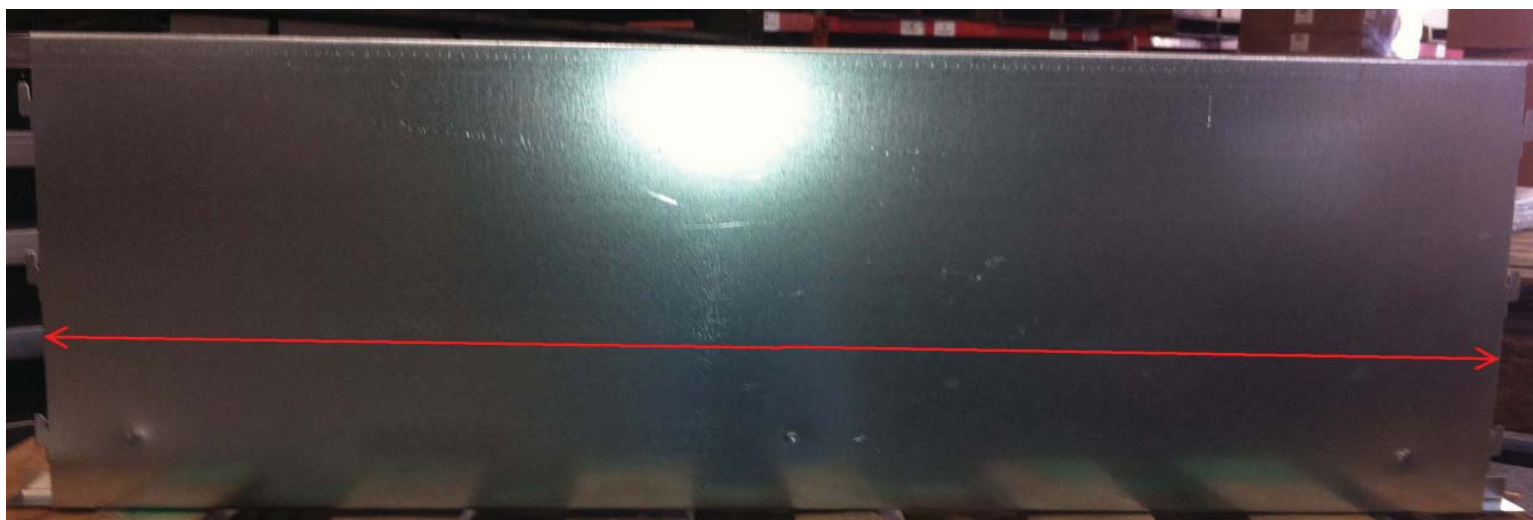

*The inside dimension of the part should equal the dimension in the **Correct** column below.

Item Number	Incorrect	Correct
14CURB3672B	37 3/8	37
14CURB90150	50 3/8	50
14CURB180240	75 1/8	74 3/4
PGC101/102/103	39 3/4	39 3/8